


SAMPLE HEAT LOSS REPORT

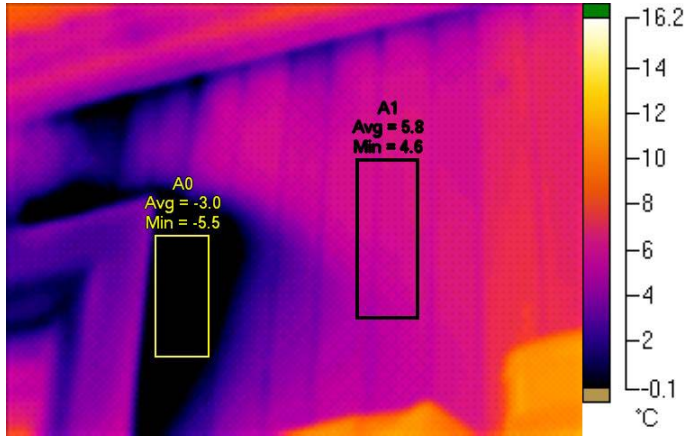


Visible Light Image

This is a very cold room and there are significant air leaks all around the patio door.

The average cold temperature in the top right corner air leak is -3.0C. We recommend removing the patio door trim and determining whether spray foam can be applied to seal air infiltration.

Name	Avg	Min	Background
A0	-3.0°C	-5.5°C	9.3°C
A1	5.8°C	4.6°C	9.3°C

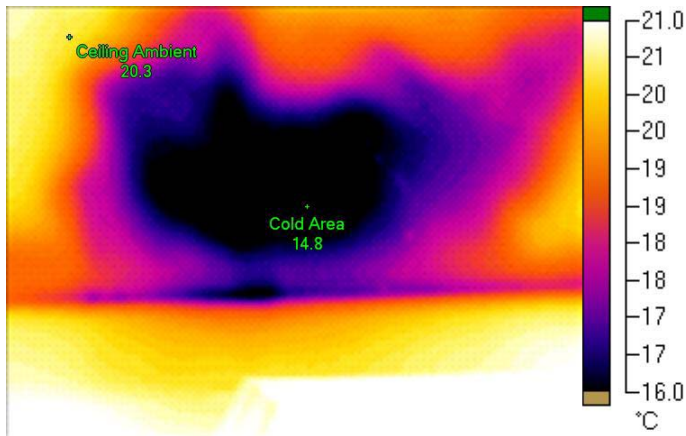

Visible Light Image

This image is a view of the bathroom ceiling taken from the floor. The cold area is due to missing insulation.

Name	Temperature	Background
Cold Area	14.8°C	20.0°C
Ceiling Ambient	20.3°C	20.0°C